
City of Baltimore Wet Smoke and Dyed	Page 1 of 1	
Sewershed: Gwynns Falls	Company: Savin	Date: 4/23/2009
Test to be performed: Smoke Dyed Water X	Ground Condition: Dry ✓ Damp ☐ Wet ☐	Supervisor: JAW
Manhole_ID: S05SS_012MH	Test ID: <u>D1032-015001</u>	Notification Made: NA (Residents, Fire, 311)

Field Sketch: Show all manholes with Numbers, Blower Placement Locations, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photo Numbers.

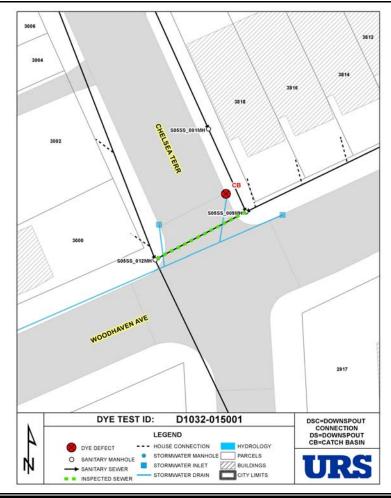

Defect Loc	Obs_ClockFrom	Obs_ClockTo	Observation	Obs_Remarks
0			Start of Survey	
0			Manhole	S05SS_009MH
0			Dye Test Visible	IR @ jt of incoming line, 1/2 GPM
0			Dye Test Visible	IN MANHOLE AT CONN. OF OUTGOING
0			General Observation	IR @ INCOMING LINE 6 oc
2			Dye Test Visible	IR @ FC, 5 gpm
2	12	12	Fracture Circumferential	
3.900000095			Dye Test Visible	@ IR & FM, 4 gpm
3.900000095	12	12	Fracture Multiple	
10			Abandoned Survey	NO MORE DYE VISIBLE